



Radio Replacement with Double DIN Dash Kit for GM Class II Vehicles 2002 - 2013

## PRODUCT FEATURES:

- Retains factory features in select GM Class II Data Bus vehicles while functioning with an aftermarket radio.
- Supports Bose, Y-91 and non-amplified audio systems.
- Retains chime functions such as: seat belt, check engine, key in ignition, low fuel, low oil and lights on.
- Retains RAP (Retained Accessory Power).
- Double DIN Dash Kit included.
- EIA color coded wiring for easy installation.

## PARTS INCLUDED:








**DKGM-C2D MODULE** 

**DKGM-C2D HARNESS** 

DOUBLE DIN DASH KIT

## INSTALLATION DIAGRAM:

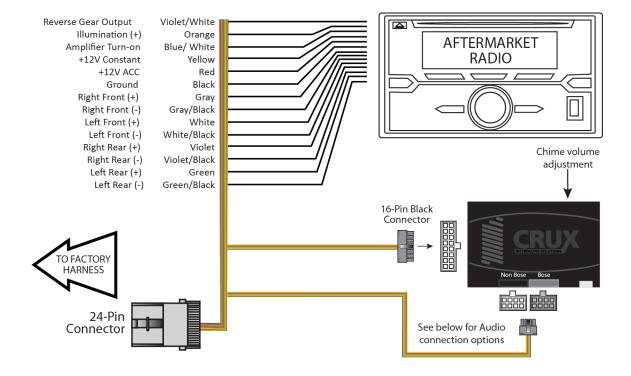

1 of 4 rev.092921





Radio Replacement with Double DIN Dash Kit for GM Class II Vehicles 2002 - 2013

## **SELECTING THE AUDIO SYSTEM:**


If the vehicle is equipped with an amplified audio system, the DKGM-C2D has a built-in audio level adaptor that outputs the proper audio level from the aftermarket radio to the factory amplifier. To use this feature, plug in the male 8-pin connector on the DKGM-C2D harness to the GRAY female 8-pin connector on the DKGM-C2D module. The module is also labeled "Bose" and "Non Bose" to avoid confusion. (see picture below)

If the vehicle is NOT equipped with a factory amplified system, plug in the male 8-pin connector to the BLACK female 8-pin on the DKGM-C2D module.



### **CHIME VOLUME ADJUSTMENT:**

The DKGM-C2D has a potentiometer to adjust the chime volume. It is set at half way by default. To adjust the volume, simply use a suitable screw driver and turn the potentiometer clockwise to increase the volume and counter-clockwise to decrease the volume.

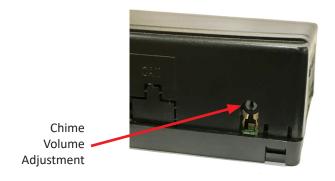

rev.092921







Radio Replacement with Double DIN Dash Kit for GM Class II Vehicles 2002 - 2013

## **DASH KIT INSTALLATION:**


Please make sure that you have all the parts as shown.

- (1) Main trim ring
- (1) Left ISO mounting bracket
- (1) Right ISO mounting bracket

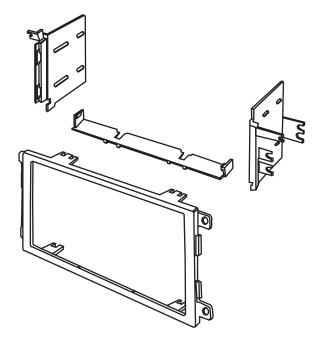

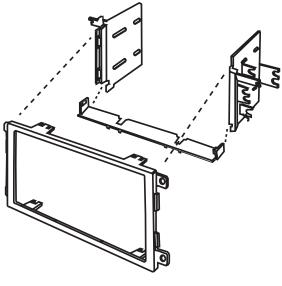

For some Cadillac installation, see diagram below:

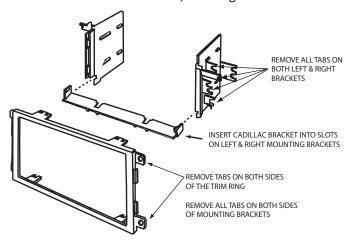

3 of 4 rev.092921

Radio Replacement with Double DIN Dash Kit for GM Class II Vehicles 2002 - 2013

# VEHICLE APPLICATIONS:

Buick		GMC	
2004-2005	Century	2004-2011	Canyon
2005-2007	LaCrosse	2002-2009	Envoy
2004-2007	Rainier	2003-2007	Savana
2003-2005	Rendezvous	2003-2006	Sierra
2005-2007	Terraza	2007	Sierra Classic
Cadillac		2003-2006	Yukon
2004-2006	Escalade	Hummer	
Chevrolet		2003-2007	H2
2003-2006	Avalanche	2005-2009	Н3
2000-2005	Cavalier	Isuzu	
2004-2013	Colorado	2003-2008	Ascender
2006-2013	Corvette	Oldsmobile	
2004-2007	Express	2001-2004	Alero
2000-2005	Impala	2002-2004	Bravada
2000-2005	Monte Carlo	2000-2004	Silhouette
2003-2004	S-10	Pontiac	
2003-2006	Silverado	2001-2005	Aztek
2007	Silverado Classic	2001-2005	Grand Am
2003-2006	SSR	2004-2008	<b>Grand Prix</b>
2003-2006	Suburban	2000-2006	Montana
2003-2006	Tahoe	2000-2005	Sunfire
2002-2009	Trailblazer	Saab	
2005-2008	Uplander	2005-2008	9-7X
2003-2005	Venture	Saturn	
		2005-2007	Relay

#### NOTE:

There are instances on the Corvette when the chime will sound when either the "Traction Control" or the "DIC" (Driver Information Center) buttons are pressed.



**Traction Control Button** 



**Driver Information Center Buttons** 

4 of 4 rev.092921